



March 6, 2017

In accordance with House Bill 512, establishing requirements governing lead and copper testing, the accompanying information is submitted by the HF Group LLC, located at 8844 Mayfield Rd., Chesterland Ohio, PWS ID # OH2846512.

The accompanying information includes:

- Map showing land parcel and building outline
- Building history
- Building diagram showing water system and plumbing that may contain lead, as well as replaced plumbing and fixtures from 2014 upgrades.
- Spreadsheet for Holding Tank and plumbing and fixture replacement
- Spreadsheet for lead and copper sample sites
- Drinking Water Lead & Copper Monitoring Reports


We do recognize that buildings built prior to 1988 or that use plumbing material or solder manufactured before 1988 may have materials with greater than 8% lead and are at a higher risk of contributing lead to the drinking water than materials manufactured after 1988. In addition, buildings built and plumbing materials manufactured after 2014 were required to have less than 0.2% lead by weight and have the lowest risk of contributing lead to the drinking water. It should be noted however that, although prohibited, some use of leaded solder or leaded components may have occurred after the prohibition became effective.

In our mapping we have noted original components to the water system in pink and components replaced in green (valves, piping & fixtures) and blue (holding tanks).

If you should need further information, I can be reached at jbratton@hfgroup.com or 440-729-9411.

Jim Bratton
Vice President & General Manager
HF Group - OH



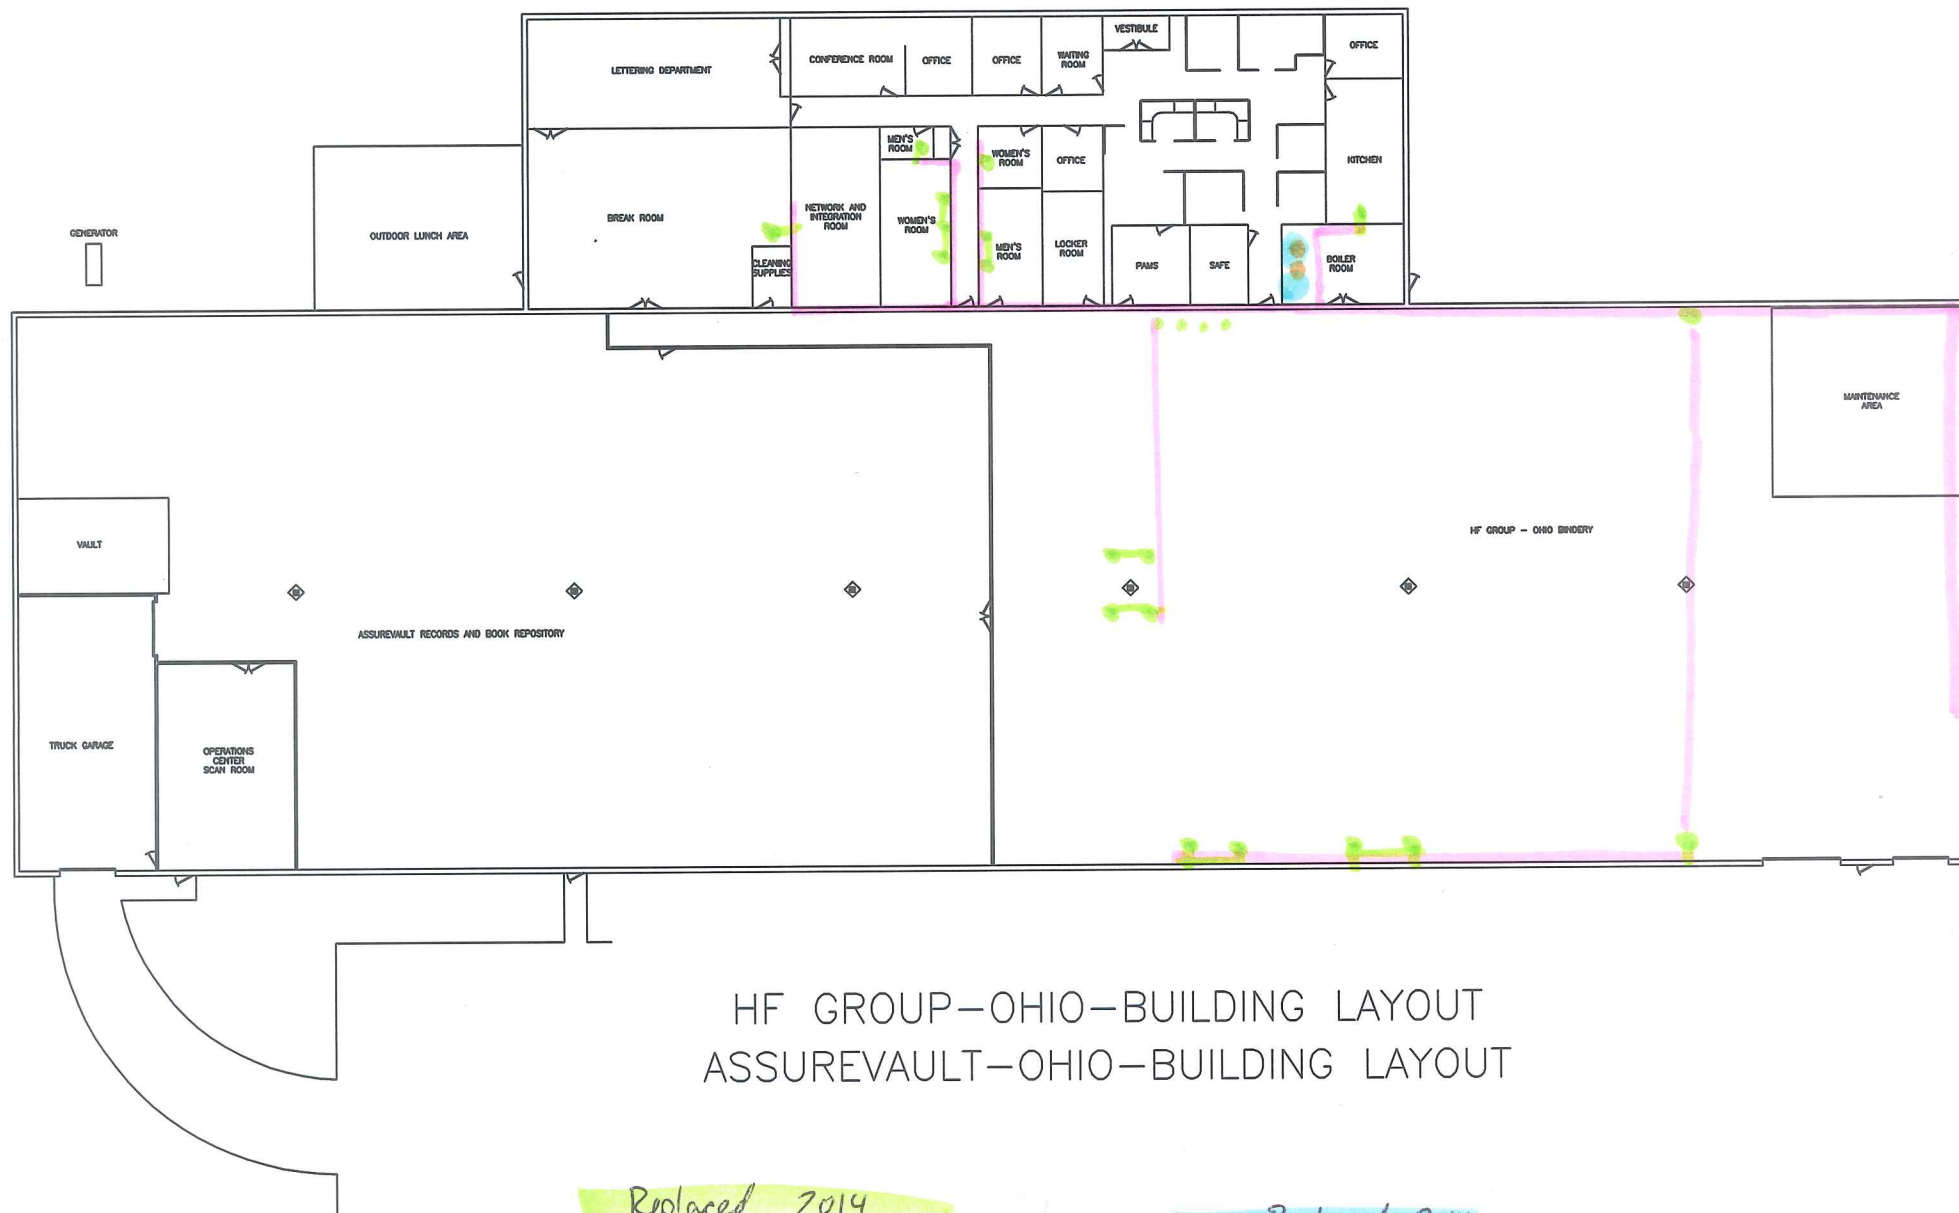

Replaced 2014

Replaced 2014

Original



HF Group LLC
8844 Mayfield Rd.
Chesterland, OH 44026
PWS ID # OH2846512

Building Built

1969

Approx 38,000 sq. feet

Includes

Office, manufacturing space and warehouse space

Water System

Well

Upgrades

** 2 Holding Tanks replaced May, 2014

** All Shut off valves, water lines to faucets &
faucets replaced Sept – Dec 2014

Faucet Inventory and Replacement Record								
LOCATION	INSTALLATION DATE	TYPE	MANUFACTURER	MODEL #	Test Date	Sample Date	Cu	Pb
Office - Kitchen								
1	5/28/2014	Chateau	Moen	7425	9/11/2014	12/15/2014	0.02mg/L	<0.002mg/L
Office - Water Cooler								
1 - w/filter	7/12/2014	Xstream Water	Macke	XFTS1	12/22/2014	12/22/2014	<0.01mg/L	<0.002mg/L
Office - Ladies RR								
1	7/12/2014	M-Bition	Moen	8430	12/15/2014	12/15/2014	0.02mg/L	<0.002mg/L
2	7/12/2014	M-Bition	Moen	8430	12/22/2014	12/22/2014	0.03mg/L	<0.002mg/L
Office - Men's RR								
1	5/23/2014	M-Bition	Moen	8430	12/15/2014	12/15/2014	0.02mg/L	<0.002mg/L
Shop - Ladies RR								
1	10/1/2014	M-Bition	Moen	8430	12/15/2014	12/15/2014	0.02mg/L	<0.002mg/L
2	10/1/2014	M-Bition	Moen	8430	12/22/2014	12/22/2014	0.03mg/L	<0.002mg/L
3	10/1/2014	M-Bition	Moen	8430	12/22/2014	12/22/2014	0.02mg/L	<0.002mg/L
Shop - Men's RR								
1	10/3/2014	M-Bition	Moen	8430	12/15/2014	12/15/2014	0.02mg/L	<0.002mg/L
2	10/3/2014	M-Bition	Moen	8430	12/22/2014	12/22/2014	0.03mg/L	<0.002mg/L
Shipping								
1	10/8/2014	Adler	Moen	CA87526	12/22/2014	12/22/2014	0.06mg/L	0.004mg/L
Check-In								
1	10/9/2014	Adler	Moen	CA87526	12/22/2014	12/22/2014	0.06mg/L	<0.002mg/L
Casemaking								
1 (by thermostat)	10/10/2014	Service Sink Faucet	Chicago Faucet	305-RCF	12/22/2014	12/22/2014	0.28mg/L	0.012mg/L
2	10/10/2014	Pre-Rinse Spring Action	Tands	B-0163	12/22/2014	12/22/2014	0.08mg/L	0.005mg/L
3 (by glue pump)	5/29/2014	Service Sink Faucet	Chicago Faucet	305-RCF	9/11/2014			
4 (by sprayer)	5/29/2014	Service Sink Faucet	Chicago Faucet	305-RCF	12/22/2014	12/22/2014	0.07mg/L	0.007mg/L
Ultrabind								
1	10/10/2014	Service Sink Faucet	Chicago Faucet	305-RCF	12/22/2014	12/22/2014	0.04mg/L	<0.002mg/L
2	10/10/2014	Pre-Rinse Spring Action	Tands	B-0163	12/22/2014	12/22/2014	0.04mg/L	<0.002mg/L
3	10/10/2014	Pre-Rinse Spring Action	Tands	B-0163	12/22/2014	12/22/2014	0.03mg/L	<0.002mg/L
Page Attachment								
1	6/20/2014	Service Sink Faucet	Chicago Faucet	305-RCF	9/11/2014	12/22/2014	0.06mg/L	<0.002mg/L
2	6/20/2014	Service Sink Faucet	Chicago Faucet	305-RCF	12/22/2014	12/22/2014	0.05mg/L	<0.002mg/L
3	6/20/2014	Service Sink Faucet	Chicago Faucet	305-RCF	12/22/2014	12/22/2014	0.06mg/L	<0.002mg/L
4	6/20/2014	Pre-Rinse Spring Action	Tands	B-0163	12/22/2014	12/22/2014	0.06mg/L	<0.002mg/L
Pressure Tank	5/3/2014	Flexcon Pressure Tank	Flexcon	FL-40	9/11/2014			