

The Village of Williamsburg does not have any lead services, I have maintenance records of jobs / digs that have been performed to the village's water system from 2011. In that time we have done 12 digs involved service lines and none of them have been lead, only copper and plastic. We have also performed meter changes out in the last few years and also meter setter replacement and have not seen any lead services either. I have worked with Williamsburg starting in 2005 and have yet to see any lead services as well.

The Village of Williamsburg has not had any water mains installed since 2013, so we have the potential to have compounds that may contain lead; the mains are labeled on the village map. Along with the water towers, water meter pits.

Buildings in Ohio built prior to 1998 or that use plumbing material or solder manufactured before 1998 may have materials with greater than 8% lead and are at a higher risk of contributing lead to the drinking water than materials manufactured after 1998. In addition, buildings built and plumbing materials manufactured after 2014 were required to have less than 0.25% lead by weight and have the lowest risk for contributing lead to the drinking water. It should be noted however that, although prohibited, some use of leaded solder or leaded components may have occurred after the prohibitions became effective.

Kyle Cribbet

Village of Williamsburg

Water Operator

**VERIFICATION FORM FOR COMMUNITY PUBLIC WATER SYSTEMS
CLAIMING NO LEAD SERVICE LINES**

The owner or operator of all community public water systems must identify and map areas of their distribution system that are known or are likely to contain lead service lines. Systems must submit a copy of the applicable map to the Ohio Department of Health and the Ohio Department of Job and Family Services. Systems must also submit a report to the director containing at least both of the following: (1) The applicable map with narrative, and (2) A list of sampling locations used to collect samples as required by Ohio Revised Code (ORC) Section 6109.121 and any rules adopted thereunder, including contact information for the owner and occupant of each sampling site.

Should a water system determine no lead service lines exist in their distribution system, they must provide information stating they reviewed, at the minimum, historical permit records and local ordinances, distribution maintenance records and information pertaining to installation dates or materials for all services lines. This information must be verified below.

I HEREBY CERTIFY THAT THE FOLLOWING METHOD(S) WERE USED TO DETERMINE NO LEAD SERVICE LINES EXIST IN THIS WATER SYSTEM'S DISTRIBUTION SYSTEM, AS REQUIRED BY ORC 6109.121(F):

LEAD SERVICE LINE VERIFICATION

This PWS states they have no lead service lines and has reviewed the following information (select one or more of the following):

- ☐ Historical permit records and/or local ordinances
- ☒ Distribution maintenance records (i.e. meter replacement, waterline break repairs)
- ☐ Information pertaining to installation dates for all service lines (i.e. after 1986 when lead services lines were banned)
- ☐ Service line material of all service lines is known (i.e. all service lines are known to be PVC)



Signature of Responsible Person

2-23-17

Date

Kyle Cribbet Operator

Printed Name and Title of Responsible Person

PWS NAME: Village of Williamsburg

PWS ID: OH1301411

COUNTY: Clermont

For Ohio EPA use only:

Date Verification Rec'd: _____

2011

Sept 13th Tuesday - replacing bottom seal/gasket in the fire hydrant on the corner of corner stone dr and tod's run road. (KC) - Rob Salesman, 10:00-12:00 hrs

dirty water calls from old 32, checked clermont county's last fire hyd water was brown, called them to let them know. (KC) 2:30-3:30 hr

Sept 14 wednesday flushing fire hyd & bulk water house, used 3,500 gallons est. KC

Oct 5 2011 wednesday - rebuilt gate valve on 133 by hill top, replaced Bolts & gaskets, water main shut down for 4hrs fire hyd flushing for 12hrs. KC JB DK est water used 25,000 gallons.

Dec 12, 2011 monday - main break on east main street between happy lane and dela pama road, 8in main with crack around pipe. KC, KB, CW, JB water main shut down 2 hrs flushing fire hyd for 5.5hrs est water used 50,000 gallons and

★ Dec Jan 3, 4 2012 - water leak repair, Paradise Ln & East main st. Dug 75ft estimated checked every bell fitting on C-900 6in, checked valve at main connection not leaking. found old water line was leaking crimped line and put shut off on it. KC, JB, CW

★ Jan 23rd 2012 - Dug at Paradise and ^{east} main st
found 3 ^{old} services disconnected them
checked around gate valve could not
find any other leaks. KC JB CW

Feb 1st 2012 - Clermont county and Williamsburg
worked on the Old 32 cross connect. Replaced
Valves + meters. Flushed hyd to clean it up
est 11,000 gallons. JB, CW

March 5th 2012 - Smelly water complaint
at 434 South Broadway. Flushed fire hyd dead
end of South Broadway 3:30 - 10:00 G.S hrs est 10,000 gal

March 22nd 2012 - Replaced fire hyd dead end
on South High Street. Flushed fire hyd after
install. est 4,000 gallons KC JB CW

April 11th 2012 - Replaced fire hyd after being
hit in traffic accident. East main + Hagemans
no water shut off or flushing KC, JB, JC, CW

May 14th - 17th Monday - Thursday Fire hyd
flushing the whole system KC JB JC CW

June 19th + 20th 2012 - Aqua line checking
for leaks in town. check whole system
found 1 - Todd's run 1 - Spring st 1 - valve at main + 183
and few fire hyd's. JB.

* June 25th - Repaired Service line leak at
Todds run road. found by Aqua line.
KC, JB, CW, JL.

Oct 9th 2012 Tuesday - repair main attached to
gate valve on east main st. was leaking
9:00-2:00 KC JL JB CW. hyd flushing est
water used

Nov 3rd 2012 Saturday - Repair main at 3131 old 32
KC, JL, CW

Nov 30th 2012 Friday - Truck Hit fire hydrant at
North 4th & walnut st. Replaced with new hydrant
and valve. Moved hydrant back 3ft. KC JL CW. 9:00-3:00
Flushed est 20,000 gallons

Dec 2nd Sunday ²⁰¹² - Repair main break on 133, 50ft from
east main st. Cut out 30 inches of 8in main. flushed
est 5,000 gallons. KC JB JL CW 9:00^{pm} - 4:00^{am}
Brown county turned on emergency water connection
12-2-12 and shut it back off 12-3-12 for a total
usage of 68,500 gallons

Jan 10th 2013 Thursday - 4in main cracked right
near bell. Cut out 16 inches of pipe installed plastic
pipe and 24in Clamp. 146 North 2nd Street.
KC JB JL. 11:00-2:30 repair. 2:00-5:30 flushing hyd
at front and gay. est gallons 20,000

2013

* June 17th - July 3rd Install new water main on 200 Block of South 6th street. And 11 services and 1 fire hyd. total water flushed new main 50,000 - 75,000 gallons. water Bact test taken to Clermont County water plant. Passed, KC JB CW JL ; H&H contractors

KC, JB July 15th monday - Main leak (Bell leak) at 6th JL, CW and main. Cut 30 inches out of main and installed C-900 back, flushed fire hyd at 8th street for 5 hrs till clear & had chlorine, flushed est 20,000 gallons

July 15th monday - Main break at 581 gary st. Shut down water, found pressure hole & crack Break. had a repair clamp next to it. removed clamp and removed some more main. Installed new piece of C-900 27 inches and installed new clamps. flushed fire hyd at 5th & gary 10,000 est gallons. & 200 Block of North Broadway 12,000 est gallons
KC, JL, CW, JB

July 23rd tuesday - Replaced Valve at South Broadway and spring st. Flushed fire hyd 7,500 gallons
KC JB CW JL

August 30th Friday - water main break on Williamsburg Bantam in church's 2nd driveway. Gin main pressure break. Fixed live. 70,000 to 100,000 gallons used
KC JL CW

2015

Feb 7th & 8th Saturday/Sunday → Pipe Shift and leaking out of gaskets. Main break on Bridge by car wash. Called had Brown city emergency water turned on. Replaced about 5ft of ductal main with plastic, New gaskets & mega lugs, and braced pipe backup. Called engineers B+N in ~~to~~ ODOT to fix it per mentally, KC JB & JL. est leak total 100,000 gallons flushing total 15,000 gallons

Feb 11th Wednesday - leaking gate valve at 805 west main street, dug and replaced. KC CW JL JB Flushed 2 line hyds est 10,000 gallons

March 6th Friday - 783 - 795 Willow st, Removed 15in repair clamp and put in a 20in clamp due to a small hole next to the clamp. Flushed 1200 gallons to clean up water - KC JL JB

May 27th 2015 Wednesday - 444 gay st, crack in main by tap. Removed tap, Banded pipe, re tapped with saddle. Flushed 8,000 gallons of water. KC CW, JB, JL

* June 9th Tuesday - 763 Spring st, hole in 3/4in copper service line. Cut out bad spot replaced with plastic repair. CW JB JL

July 23rd 2015 Thursday - Replaced valve ^{in road} and fire hyd on main st by Rail road & North high. Flushed 5,400 gallons KC, JB, JL, AS

2015

* Oct 3rd Saturday - KS ~~200~~ contractors hit a water service at 220 west main st while installing a gas service. cut 2 feet of service out and replaced JL, JB, AS.

* Oct 8th Thursday - Installed 1 1/2 in water tap at 4068 Tollgate road. Caused a main break by opening & closing valve to fast. ~~main~~ main break between 4068 & Clear mt church. Repaired with 1 1/2 in band. flushing fire hydr 6,900 gallons
KC JL JB

Nov 3rd Tuesday - Fixed small bad spot in main near Clear mountain church. fixed with 8 in band KC, JL, AS. kept main live

Nov 4th Wednesday - collected water sample to test Bact for the Bridge. 3:40 pm F-.54 T-.66 (KC)

Nov 6th Friday - Bact test came back neg. Put the water system back to one system, and shut off the brown city pit. (KC) (JL)

* Dec 3^{1st} Thursday - water service line hit in 200 Block of gay st during storm sewer install. Repaired 3/4 in water line about 10ft of it. KC CW AS

2016

13

1/25
Feb 5th 2016 Friday - 487 gay street, bell leak, removed bell. Installed short section of pipe and 24in clamp. 4in water main. KC, CW, JL, AS flushed fire hyd at the dead end of north Broadway.

March 15th Tuesday - Turned on Brown city water and shut off both Clermont city pits. (KC)

4
★ April 13th Wednesday - Install water tap at 185 west main street. KC JB JL CW

band
April 14th Thursday - Installed fire hyd on the corner of S Buay & west main st. in front of the old high school. Flushed 2,500 gallons KC JB JL

st
April 15th Friday - Switched from Brown city water to Clermont city water. (KC)

April 19th Tuesday - Install 2 water valves in the intersection of 5th & main street. Valves installed by Jackson Brothers, John Jackson 1-740-710-4396. KC, JL JB.

AS
May 9th thru 13th - fire hyd flushing.
KC JB JL

June 1st Wednesday - draining 8th street water tower due to maintenance by pittsburg tank & tower new ladders and safety climbing rails KC JL

2016

15

Oct 11th Tuesday - 257 South Broadway crack in pipe
Gin main. Put a 1 1/2 in clamp on it fixed live
CW, DH, EY, DJ, KC


Oct 11th Tuesday - got a call from the EPA about
failing a Bact sample at 107 West main st.
took 3 repeat samples at 107 West main, 134 South 4th,
and 100 West main. took samples to clermont city
BMW plant, all passed, called Gina and left
message. (KC)

* Nov 17th Thursday - main break at 3197 old st 1 & 32
found 5 in crack by the service line, then found a pin
hole on the other side of the service line. Shut down
main, repaired with clamp and installed a new
water tap. KC CW EY ME hyd flushing afterwards
was 50,000 gallons.

Nov 18th Friday - hyd flushing around town, S. Bway
Willow, Wilmar. est hyd flushing 10,000 gallons
KC ME

Nov 22nd/23rd Tuesday - Wednesday - hyd flushing
dead end of Lorylunn lane. KC

* Nov 29th Tuesday - contractor pulled water tap out
of water main at 1412 South front street, repaired
with a repair clamp with a 3/4 in tap in it. replaced
copper line to meter pit est flushing 3,000 gallons
KC, CW, EY, ME

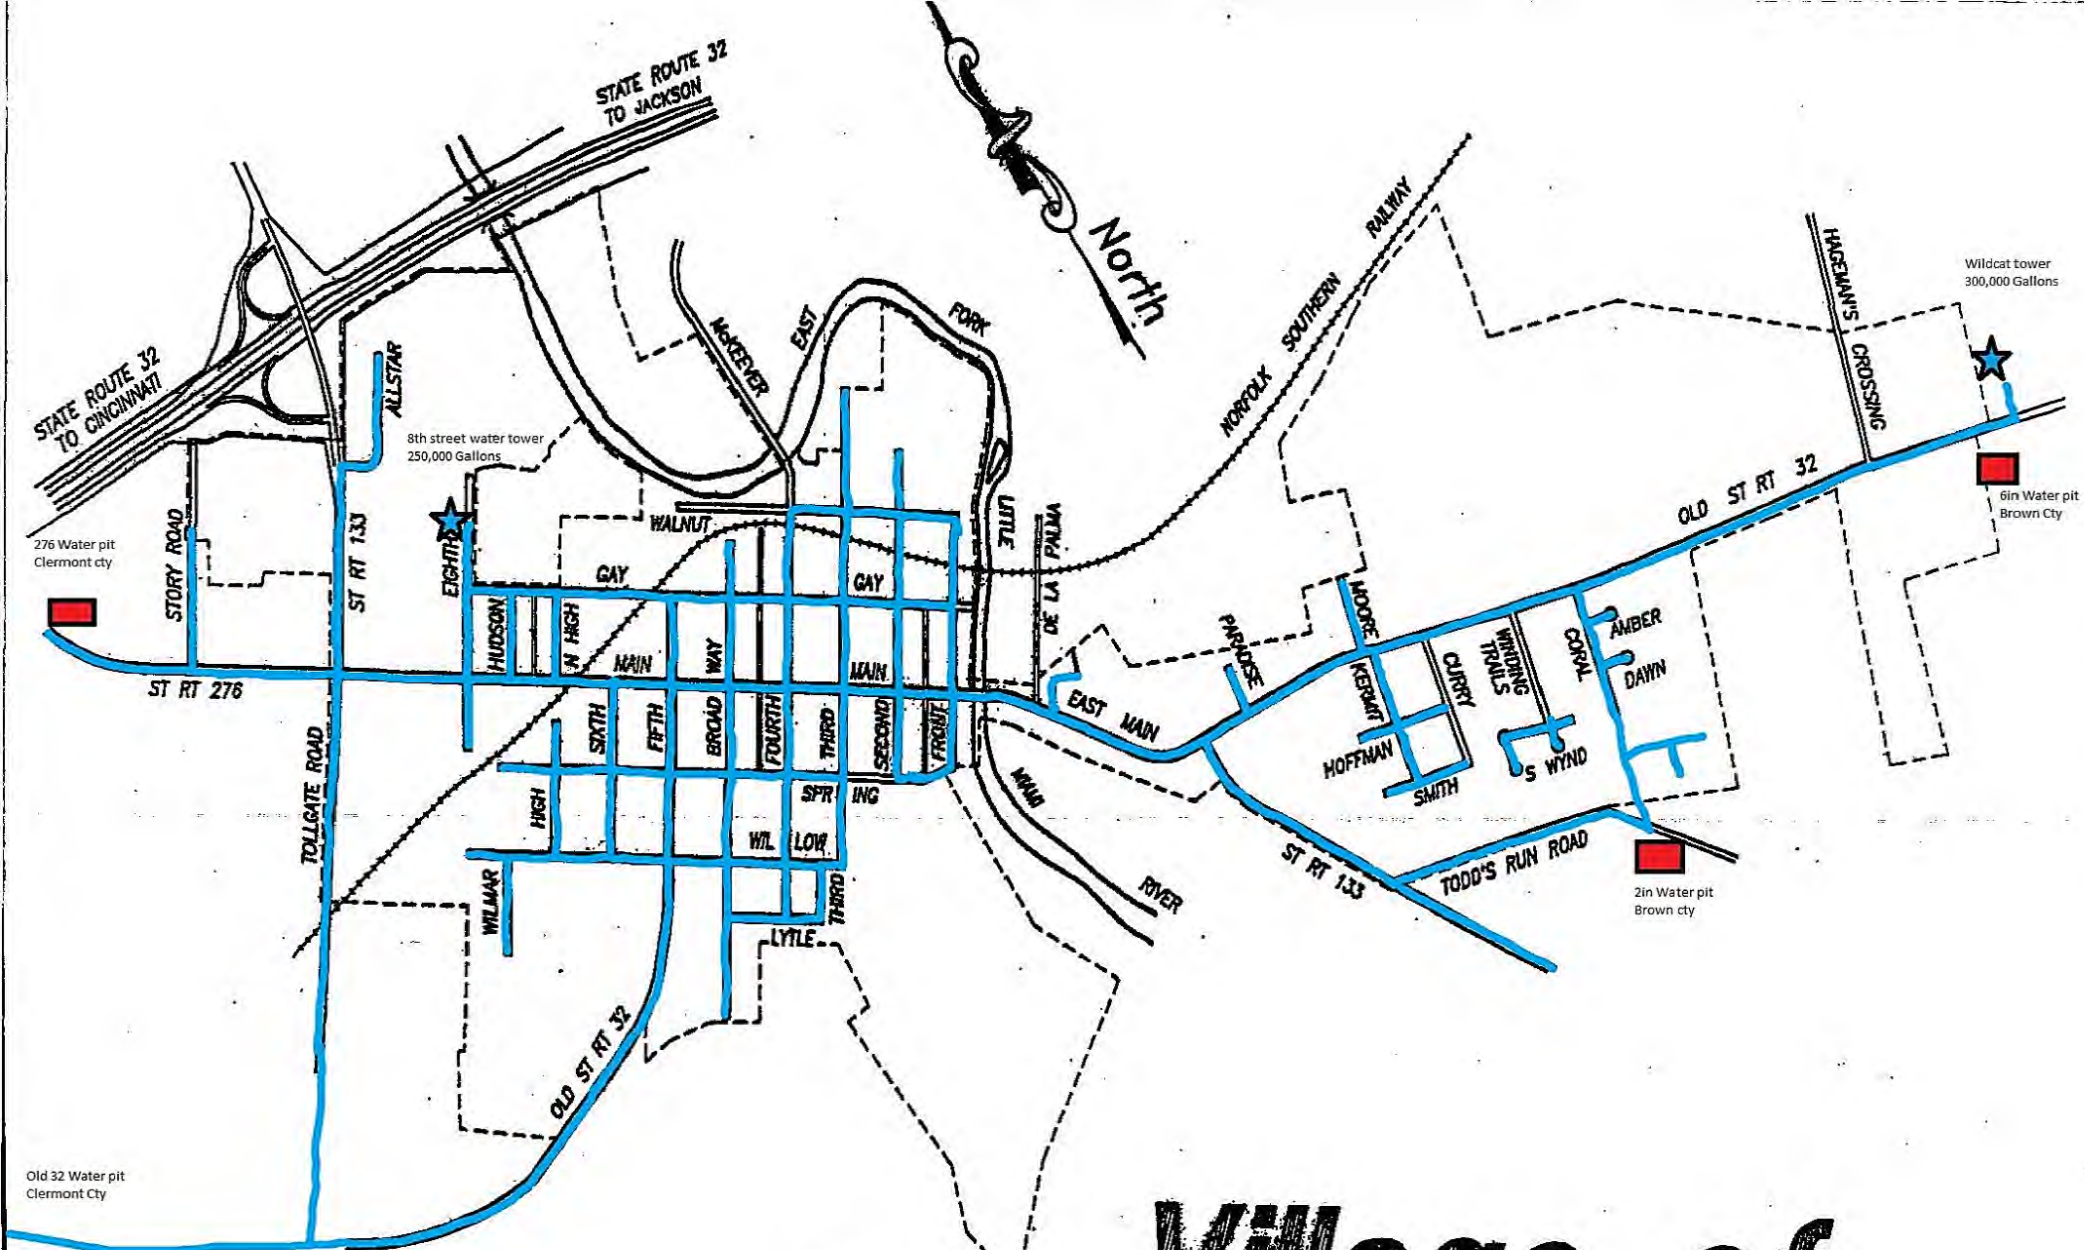

The Village of Williamsburg does not have any lead services



-Water towers



Water Meter Pits

Water lines (Ductile, Pvc C-900 with potential of lead containing components)

Village of Williamsburg

